

Gilson BROTHERS COMPANY

BOX 152. PLYMOUTH, WISCONSIN 53073. U.S.A.. PHONE (414) 893-1011

December 22, 1977

Service Bulletin #108

Subject: Wearing of recoil starter rope on Air Duct - Blower Housing (37947)


Models: #55091, 35210A, 55098 and GIS 7510A87 Compact Snowthrowers

It has been brought to our attention that chaffing and failure of the recoil rope has been experienced on some of the above models. This is caused, by the recoil rope rubbing the edge of the cut out in the #37947 Air Duct when pulling the rope vertically.

Correction of this condition is achieved, by merely indenting the area above the recoil outlet slightly with a ball-peen hammer, so the rope will clear. Fig. 1 illustrates the area which should be indented for clearance.

Warranty may be filed for this repair.

Service Department

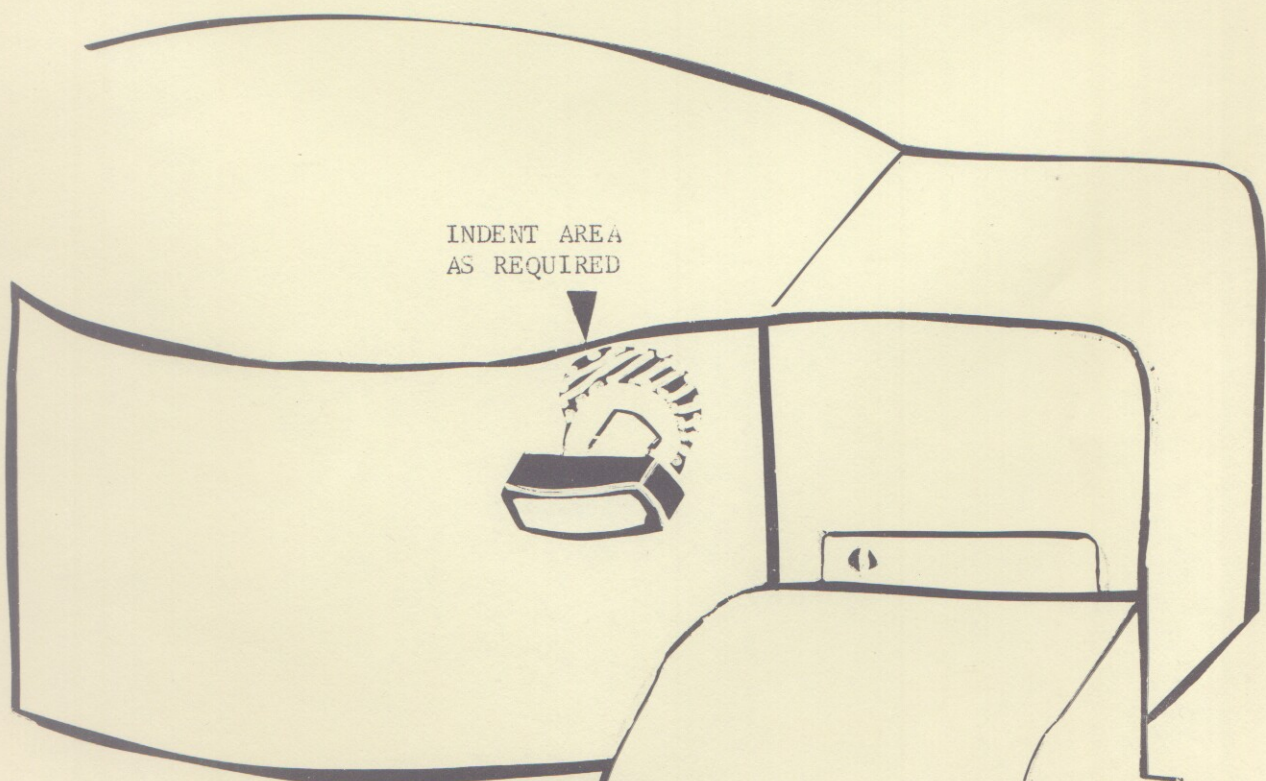

O U T D O O R P O W E R E Q U I P M E N T